


PUREON**Polishing pads**

Polyurethane impregnated felt pad, non-woven

Suba™ 1200

Suba 1200 is a very hard, low compressible pad that improves overall wafer flatness.

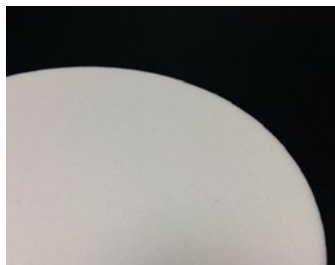

Pureon offers a variety of slurries in a wide range of viscosities and custom formulations to match Suba pads. We are happy to assist you in finding the best suitable products.

Polyurethane impregnated polyester felt pad for stock or intermediate polishing

Suba polishing pads are polyurethane impregnated polyester felts. They are specifically designed for stock and intermediate polishing where achieving a high precision surface is critical. Suba pads should be used in combination with each other and with final polishing pads to produce a haze-free, low defect finish in dual or multi-step processes. Suba pads are ideal for a wide variety of materials including semiconductor wafers, glass, ceramics, special metals and plastic. Suba 1200 pads provide improved overall flatness and site-flatness for prime wafer manufacturing processes. These pads are specifically designed to reduce pad glazing and improve process control.

Product specifications

Base materialFelt
 Shelf life12 Months
 ApplicationsCadmium zinc telluride, Lithium niobate, Lithium tantalate, Silicon carbide

Polishing pad	Base material	Compressibility %	Hardness	Hardness test	Thickness (mils)
Suba 1200	Felt	6.0	80	Shore D	50
Suba 500	Felt	13.0	55	Shore D	50
Suba 600	Felt	4.0	80	Shore D	50
Suba H2	Felt	12.25	67	Shore D	50
Suba 800	Felt	4.0	82	Shore D	50

The data presented is a statistical representation for comparison purposes. The values are not necessarily representative of the COA specifications.

Contact

sales@pureon.com

www.pureon.com/sales-contacts

Packing information

Pads are packaged face-to-face (polish side to polish side) and sealed inside a plastic bag to ensure cleanliness during transportation. The bags are taped to the side of the box to prevent the bag from slipping and damaging the pads. Pads should always remain flat. Bending pads during handling can cause wrinkles in the PSA and premature delamination of the release liner.

Suba 1200 highlights

- Available in a variety of surface textures such as grooved and plain.



Pureon offers a wide range of customize tailored solutions. More information can be found on www.pureon.com/products/overview

Instructions

Handling

Apply only to a clean, dry surface at room temperature. If an appropriate solvent, such as isopropyl alcohol, is used to clean the platen after a pad removal, allow the platen to dry completely and return to room temperature before applying a new pad. Solvents remaining on the platen or an unusually cold platen will lower PSA adhesion.

When applying the pad to the platen, peel the release liner from one edge of the pad. Fold liner back approximately 2 inches. Align the pad with the edge of the platen and adhere. In one continuous movement, slowly peel the remaining release liner off the pad while pressing the pad down on the platen. The application should be smooth and uniform with even pressure from the pad mounting tool (such as a flat disk or hand roller).

Do not try to reposition pads with PSA adhesive.

Storage

Product should be stored and transported in the original packaging. The product should be stored in temperatures between 10°C to 24°C (50°F to 75°F) and <50% humidity. Exposure for six (6) months or less to conditions between -17°C to 48°C (0°F and 120°F) and/or at relative humidity of up to 100% will not impact the product performance as long as the release liner remains intact and attached to the PSA. If the product is exposed to temperatures and humidity outside the recommended conditions, it may still be acceptable for use. In all cases, the product should be allowed to return to normal room temperatures prior to use.

Disposal

Dispose of in accordance with all applicable local regulations.